Designed for possibilities. Made for people.



Altro Tungsten



PVC-free, slip-resistant flooring










LRV 15

LRV 11



LRV 11


WR248 / A1M238

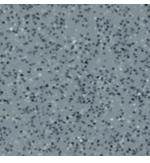






Breeze TUN20909 LRV 18 WR86 / A1M86

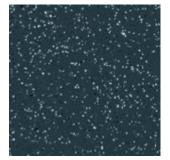

Midnight TUN203005 WR72 / A1M72

WR249 / A1M249

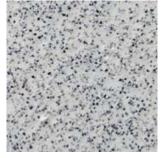

Whirlwind TUN20910 WR79 / A1M191 LRV 38



Supercell TUN20912 WR473 / A1M308 LRV 15



Gust TUN20908 WR81 / A1M81

LRV 23




TUN20906 Arcus WR101 / A1M72 LRV 11







TUN20905 Vortex WR277 / A1M100 LRV 6

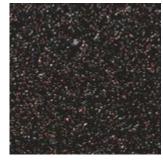

TUN20904 Firestorm WR100 / A1M100 LRV 5

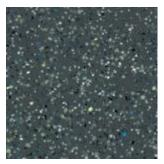

TUN203009 Storm WR82 / A1M82 LRV 16

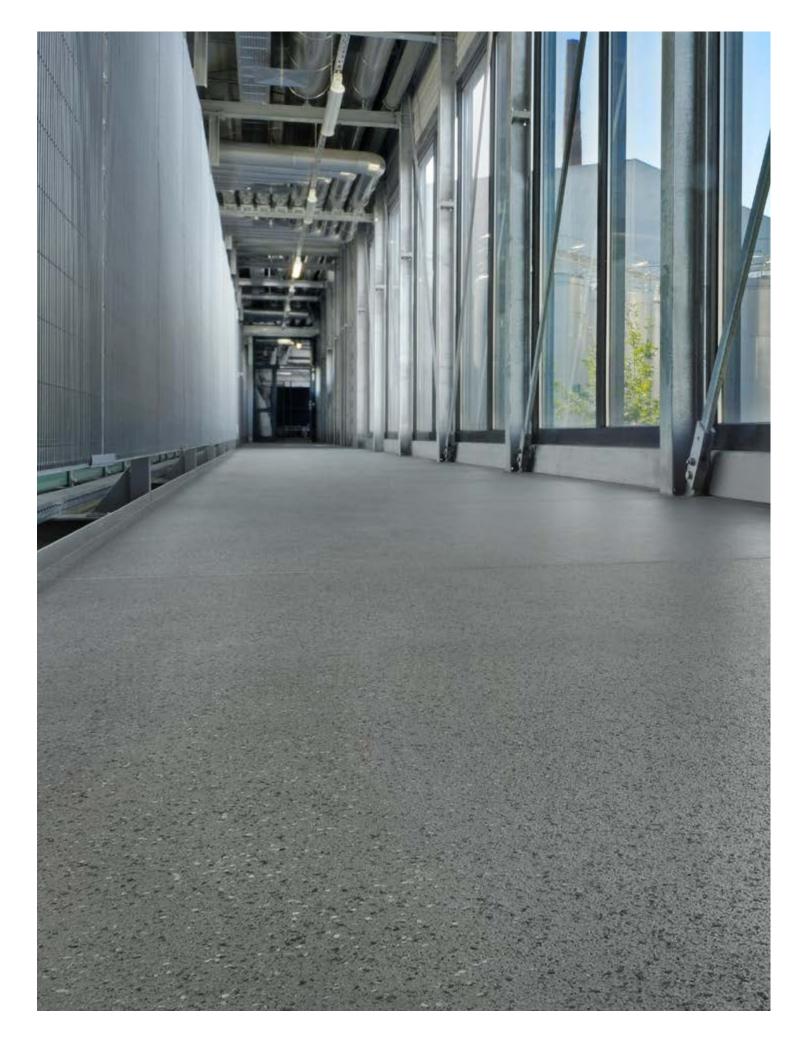

Type + classImage: Provide and the second secon	Specifications				
Roll dimensions Figure 1 Roll dimensions Image: Signe 2 Veight Image: Signe 2 Varanty Image: Signe 2 Cleaning technology Image: Signe 2 Static coefficient of friction Image: Signe 2 Filter pendulum test Image: Signe 2 Indentation Image: Signe 2 Very (abrasion) resistence Image: Signe 2 Image: Signe 2 Image: Signe 2 Indentation Image: Signe 2 Very (abrasion) resistence Image: Signe 2 Image: Signe 2	Type + class		ASTM F1303	Type II, Grade 1, Class A, smooth flooring	
Normal Normal Veight Image: Sector	Thickness and wear layer		2.0mm .08" wear layer, homogeneous construction		
Name VarantyNote SeriesVarantyImage ImageCeloning technologyImage ImageState coefficient of ficientImage ImageState coefficient of ficientImageState coefficient of ficientImage ImageState coefficient of ficientImageState coefficientImageState coefficientImage <td>Roll dimensions</td> <td></td> <td colspan="2">6'7" x 65'5 2m x 20m</td>	Roll dimensions		6'7" x 65'5 2m x 20m		
Image: Constraint of the stand of the s	Weight	<u>ل</u>	4.98 lbs./yd ² 2.7 kg/m ²² 290 lbs. per roll		
Static coefficient of friction 1.0 m ASTM D2047 1.0 dry Ramp test Image:	Warranty	10 Vear undart warmaty	10 years		
Image of the set of the	Cleaning technology	EASYCLEAN	Altro Easyclean		
TRRL pendulum test Image: content in the state in	Static coefficient of friction	1.0 D	ASTM D2047	1.0 dry	
TRRL pendulum test ASTM E303 =40 Indentation Image: Simple status EN 433 < 0.10mm	Ramp test	R ₁₁	DIN 51130	R11	
Image: Constraint of the second se	TRRL pendulum test	Pressare for PTV ≥40		≥40	
Clask generationClask generationClosk generationCastor chair abrasionImage: EN 425PassFlexibilityImage: EN 425PassLight fastnessImage: EN 20105-B02> 6Sound insulationImage: EN 20105-B02> 6Sound insulationImage: EN 1815> 4BElectrical behaviorsImage: EN 1815> 2kV AntistaticFire and smoke performanceImage: EN 20105-B02Tested Class 1 < 450	Indentation		EN 433	≤ 0.10mm	
Late of the seriesNote of the seriesFlexibilityImage: Series of the seriesLight fastnessImage: Series of the seriesLight fastnessImage: Series of the seriesSound insulationImage: Series of the seriesImage: Series of the seriesImage: Series of the seriesSound insulationImage: Series of the seriesImage: Series of the seriesImage: Series of the seriesSound insulationImage: Series of the seriesImage: Series of the series of the seriesImage: Series of the seriesImage: Series of the seriesImage: Series of the series of the seriesImage: Series of the series of the series of the series of the seriesImage: Series of the series of the series of the seriesImage: Series of the ser	Wear (abrasion) resistance		EN 660	≤ 10% 50,000 cycles	
Index Index Index Index Light fastness Image: Single American American Single American American Single American Single American A	Castor chair abrasion		EN 425	Pass	
rink Sound insulationImage: specific carbide pair of the specific carbide	Flexibility	52	ASTM F137	Pass	
Electrical behaviorsEN 1815< 2kV AntistaticFire and smoke performanceImage: State Cass I Cass I ASTM E643 ASTM E662Tested Class I Cass I<	Light fastness		EN 20105-B02	≥ 6	
Record of the second of the	Sound insulation	<u>(((ج))</u>	ISO 140-8	1dB	
Fire and smoke performanceASTM E648 ASTM E662Class I Class I	Electrical behaviors	2.0 KV	EN 1815	≤ 2kV Antistatic	
Chemical resistance ASTM E662 < 450 Chemical resistance Image: Chemical resistance ASTM F925 Tested VOC emissions Image: Chemical resistance Image: Chemical resistance Pass Cretified VOC emissions Image: Chemical resistance Image: Chemical resistance Pass Cretified Bio-based content Image: Chemical resistance Image: Chemical resistance Pass Cretified Ortho-phthalate content Image: Chemical resistance Image: Chemical resistance Image: Chemical resistance Recycled content Image: Chemical resistance Silicon carbide, aluminum trioxide and colored quarts aggregate throughout thickness of acrylic.		6			
VOC emissionsCA 01350 FloorScorePass CertifiedBio-based contentImage: CartifiedPass CertifiedOrtho-phthalate contentImage: CartifiedPass CertifiedOrtho-phthalate contentImage: CartifiedPass CertifiedRecycled contentImage: CartifiedPass CertifiedSilicon carbide, aluminum trioxide and colored quartz agregate throughout thickness of acrylic.					
VOC emissions SCORE FloorScore Certified Bio-based content Image: State in the state in th	Chemical resistance		ASTINIF925	lested	
Ortho-phthalate content Image: Content free Recycled content Image: Content free Silicon carbide, aluminum trioxide and colored quartz aggregate throughout thickness of acrylic.	VOC emissions	SCOLE .			
Recycled content Silicon carbide, aluminum trioxide and colored quartz aggregate throughout thickness of acrylic.	Bio-based content	birðsred	Manufactured with rapidly renewable bio-based content.		
Composition Silicon carbide, aluminum trioxide and colored quartz aggregate throughout thickness of acrylic.	Ortho-phthalate content	and the second s	Ortho-phthalate-free		
Composition	Recycled content	\bigcirc	This product contains 4% post-consumer recycled content.		
	Composition				
Backing Non-woven polyester/cellulose glass fiber reinforcement scrim.	Backing	Non-woven polyester/cellulose glass fiber reinforcement scrim.			
Installation and Altro flooring must be installed by a professional flooring installer that has attended an Altro Installation and training clinic. Installation procedures available at altrofloors.com/downloads, training clinic information at altrofloors.com/training. Proper care of Altro flooring is critical. Please consult our cleaning procedures available at altrofloors.com/downloads. Failure to install, heat weld, and/or maintain correctly could void the warranty.		training clinic. Installation procedures available at altrofloors.com/downloads, training clinic information at altrofloors.com/training. Proper care of Altro flooring is critical. Please consult our cleaning procedures available at altrofloors.com/downloads. Failure to install, heat weld, and/or			
Staining Certain chemicals may cause staining of flooring. Traffic stains may be caused by asphalt and	Staining	Certain chemicals may cause staining of flooring. Traffic stains may be caused by asphalt and rubber products, like rubber mats. Please conduct stain test before installation.			



Discover more of our sustainability story and credentials at altro.com



Order samples 24 hours a day at altro.com and materialbank.com



🕸 USA 800 377 5597

🕸 CANADA 800 565 4658